




SOUND ABSORPTION AREA FOR OBJECT

Measured and evaluated according to ISO 354 and ISO 20189

| | | | |
|-------------------|-----------------------------|----------|--------|
| Client: | Boom Interior | | |
| Object: | Xrozz Absorption Reinforced | | |
| Size [mm]: | w = 600 | h = 1800 | d = 40 |

| Octave band (Hz) | Equivalent sound absorption area / unit (m ² Sabine) |
|------------------------------|---|
| 63 | 0.34 |
| 125 | 0.45 |
| 250 | 0.74 |
| 500 | 0.94 |
| 1000 | 1.11 |
| 2000 | 1.35 |
| 4000 | 1.65 |
| N₁₀ = 10.6 | |

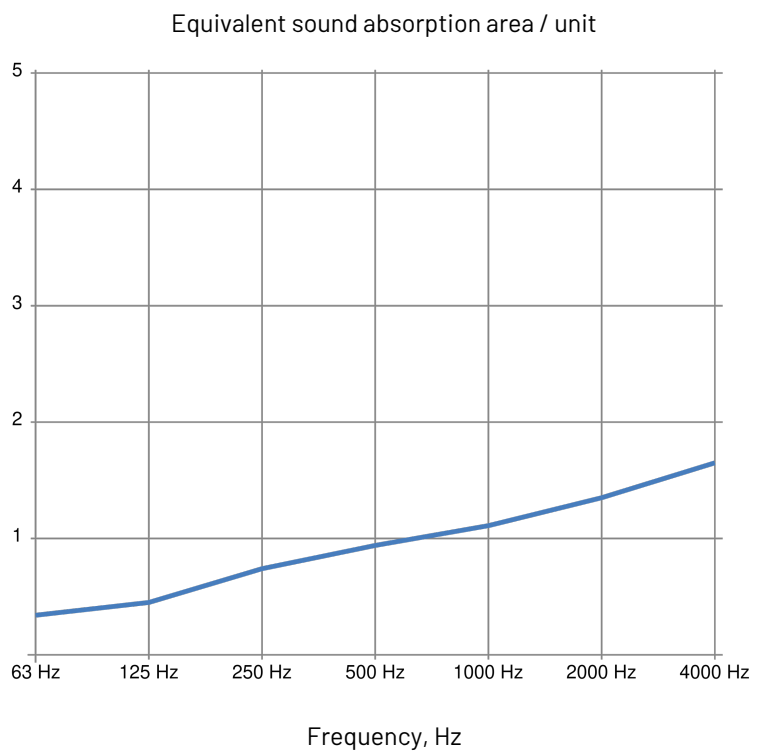

| ORIGINAL TEST REPORTS | DATE OF REPORT |
|------------------------------------|----------------|
| Akustikverkstan report 18-701-M16 | 2018-08-23 |
| Akustikverkstan report 18-701-M17a | 2018-08-23 |

The presented results are interpolated using the method described in ISO 20189 from the original test reports.

