




# SOUND ABSORPTION AREA FOR OBJECT

Measured and evaluated according to ISO 354 and ISO 20189

|                   |                           |          |        |
|-------------------|---------------------------|----------|--------|
| <b>Client:</b>    | Boom Interior             |          |        |
| <b>Object:</b>    | Xrozz Absorption Recycled |          |        |
| <b>Size [mm]:</b> | w = 600                   | h = 1000 | d = 40 |

| Octave band (Hz)             | Equivalent sound absorption area / unit (m <sup>2</sup> Sabine) |
|------------------------------|---|
| 63                           | 0.18  |
| 125                          | 0.27  |
| 250                          | 0.42  |
| 500                          | 0.52  |
| 1000                         | 0.6   |
| 2000                         | 0.74  |
| 4000                         | 0.94  |
| <b>N<sub>10</sub> = 19.2</b> |   |

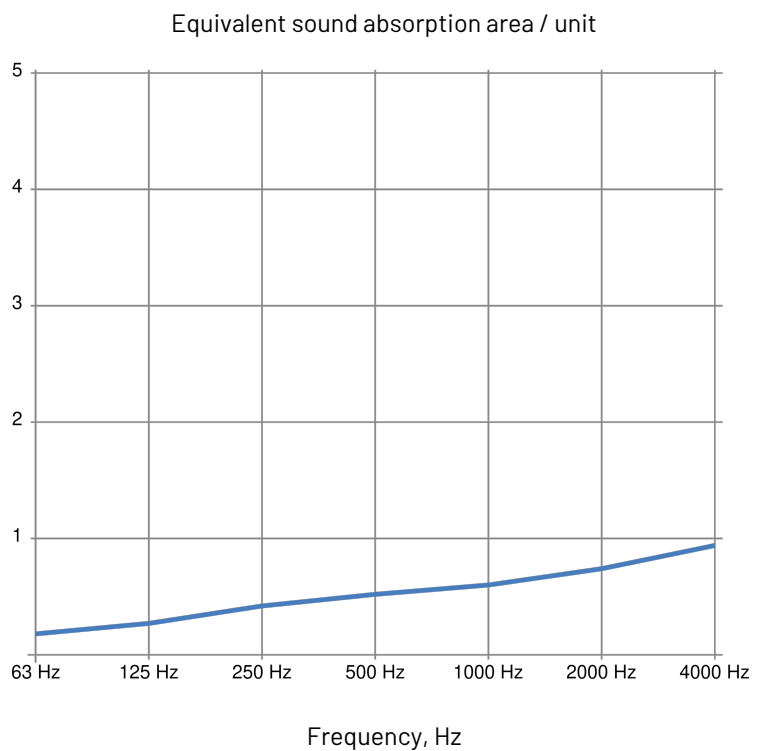

| ORIGINAL TEST REPORTS             | DATE OF REPORT |
|-----------------------------------|----------------|
| Akustikverkstan report 18-701-M1a | 2018-08-23     |
| Akustikverkstan report 18-701-M2a | 2018-08-23     |

The presented results are interpolated using the method described in ISO 20189 from the original test reports.

